



STRONG ENTERPRISES

A DIVISION OF S.E. INC.

11236 Satellite Blvd.

Orlando, FL 32837

(407) 859-9317

Fax: (407) 850-6978

PRODUCT GROUNDING AND RECALL

PRODUCT BULLETIN #16

JULY 15, 1992

SPECIFIC TANDEM 3-D RINGS GROUNDED

STATUS: Mandatory. Affected 3-D rings must be replaced by Strong Enterprises before next jump.

IDENTIFICATION: Instructor harnesses of following Dual Hawk Tandem Systems, PN 1165-4 (Ref: assembly drawing 1151):
Serial numbers 107067-206098
Manufactured between July 1991-June 1992.
Except those with replaced rings which have a lot number stamped on the front of the 3-D ring.

PROBLEM BACKGROUND: We have discovered two 3-D Rings from this lot of hardware that deformed because they were not hardened (tempered) properly. As a matter of precaution, we will replace the 3-D rings on the affected Dual Hawks.

REQUIRED ACTION: Check serial number and date of manufacture. Stop using the affected equipment immediately. Remove the handles and reserve. Send the harness/container assembly to Strong Enterprises prepaid. The replacement of the rings and shipping both ways will be free of charge if returned to Strong Enterprises by October 1, 1992. We will return equipment via the same carrier and priority. We anticipate a turn-around time of 2 weeks maximum.

AUTHORITY: Address all inquiries to our Tandem Department.

DISTRIBUTION: Registered owners by serial number, DHT Examiners, parachute publications, FAA.