

Issued by: Sächsische Spezialkonfektion GmbH
Nordstr. 40
02782 Seifhennersdorf
GERMANY

Subject: Pilot Chute at Emergency Parachutes,
Type RE-5L, Seria 4 und 5, (LBA.040.010/89 JTSO)
Manufact.-No.: 72245 – 72371, except 72370
Manufact. Date: 21.04. – 21.08.2008 (Date of EASA
Form 1)

Reason: Pilot chutes as part of Emergency Parachutes RE-5L,
produced and delivered in-between the above mentioned
period, may have damaged (chapped) grommets at the top
(see Fig. 2).
In extreme case it may happen an obstruction of the closing
loop by a damaged grommet and further on the proper
opening of the parachute container may be obstructed.



Fig. 1: Pilot chute

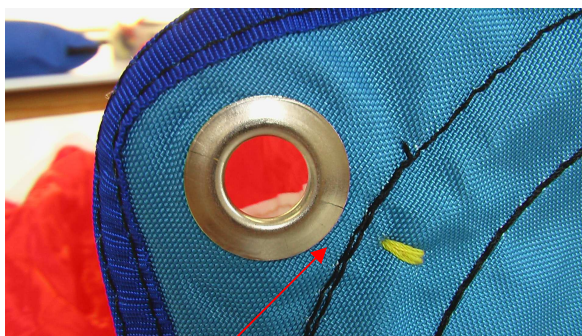


Fig. 2: Grommet

Tear

Requested action: Replacement of Pilot Chute at all Emergency Parachutes RE-5L with the Manufacturing-No's 72245 – 72371, except 72370, produced and delivered in-between the period 21.04. – 21.08.2008 (Date of EASA Form 1)

Status: binding

Coming into force: immediately

Realization: see enclosure

Seifhennersdorf, 15.09.2008

ppa. Harald Wilhelm
Prokurist

Enclosure to SAFETY BULLETIN No. 01/2008

Realization:

Realization can be done as follows:

- by re-sending the complete parachute to

SPEKON
Sächsische Spezialkonfektion GmbH
Nordstrasse 40
D-02782 Seifhennersdorf
GERMANY
- Through an authorized Master Rigger who has a national qualification for rigging Emergency Parachutes

How to proceed by realization through an authorized Master Rigger:

- ***Requesting the Pilot chutes:***
By Telephone, Fax or email to company SPEKON:
 - Tel.: +49 (0)3586 456 -0
 - Fax: +49 (0)3586 456 167
 - Email: info@spekon.com

With information for what Manufacturing No. the Pilot Chute is requested.

- ***Scope of work:***
 - Opening the hand-made securing stitch an the connecting point Pilot Chute – Connecting Line
 - Replacing the Pilot chute
 - Set the hand-made securing stitch between the Pilot Chute and the Connecting Line by using sewing yarn Nm 11/3
 - Confirming the action by signing in the Parachute Log-Book (page 10) with following Text: *Safety Bulletin SPEKON 01/2008 realized*
 - Re-sending the replaced Pilot Chute to SPEKON
- Contacts at SPEKON for all question around the Safety Bulletin are:
 - Harald Wilhelm Tel. 03586 456 145 wilhelm@spekon.com
 - Jens Thumeyer Tel. 03586 456 124 thumeyer@spekon.com
 - Ilona Christoph Tel. 03586 456 146 christoph@spekon.com