



Deutscher Fallschirmsportverband (DFV) e.V.

An alle Halter/Vereine/Schulen/Fallschirmtechniker/Fallschirmwarte

Information für AAD

Herausgegeben: 20. April 2026

Nummer: INFO 2026-02 AAD Vigil Cutter Lebenszeit

Bezug: PIB-01-2026 Vigil Cutter Service Life

Betroffene Muster: Vigil Cutter (siehe PIB)

Maßnahmen: Kontrolle Service Life des Cutters

Durchzuführen bis : bei der nächsten bzw. jeder Wartung

Durchzuführen von: Fallschirmtechniker / Fallschirmwart

Dokumentation: Service Life : Datum (auf der Begleitkarte eintragen)

Bemerkungen: Der Cutter darf nicht mehr als 6 Monate älter sein, als das Gerät an dem er verbaut ist.
Das Herstellungsdatum des Cutters findet man auf dem Cutter.
Im Anhang die originale Meldung des Herstellers.

Verteiler: Techniker, Warte, Händler, Vereine, Sprungzentren, Halter

Ablage: ParaOrg : 2026-02 AAD Vigil Cutter Lebenszeit

DFV-Überherrn, den: 20. April 2026

Gremium Technik DFV

PRODUCT INFORMATION BULLETIN

Issue Date : 16th April 2026

Bulletin Number : PIB-01-2026

Subject : Vigil Cutter Service Life

Background :

Multiple Vigil units have been returned to our Service Department, and during inspection, the units were found with a replacement cutter that had a DOM older than 6 months prior to the DOM of the Vigil unit. Use of a cutter that is older than 6 months prior to the DOM of the Vigil unit could possibly result in the cutter exceeding its Service Life

Compliance :

Vigil cutters placed on any Vigil unit should not be older than 6 months prior to the DOM of the Vigil unit.


New or used Vigil AADs with a cutter DOM older than 6 months prior to the DOM of the Vigil unit should not be installed in any parachute rig.

If the age of the cutter exceeds 6 months prior to the DOM of the Vigil unit, the complete Vigil unit should be sent back to the factory for servicing and cutter replacement. For Vigil 2+ AADs, the cutter can be replaced in the field.

The expected Service Life of a Vigil cutter is 20 years + 6 months.

Identification :

Vigil Cutter DOM MM/YY

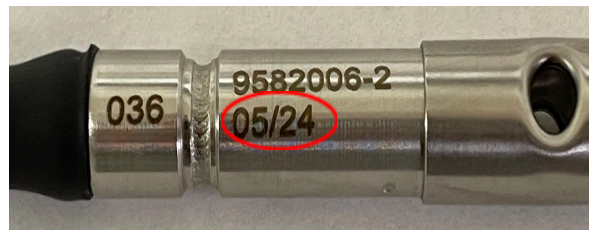



Authority:

Sven Ibens
Managing Director

AAD nv/sa - Advanced Aerospace Designs
220 Luikersteenweg, 3700, Tongeren, Belgium
+32 12 210 250
info@vigil.aero

Vigil America, Inc
1400 Flightline Blvd suite "C"
Deland, FL 32724 - USA
+1 386-736-8464
info@vigilamerica.com

www.vigil.aero